



2-98 Anemone 1A

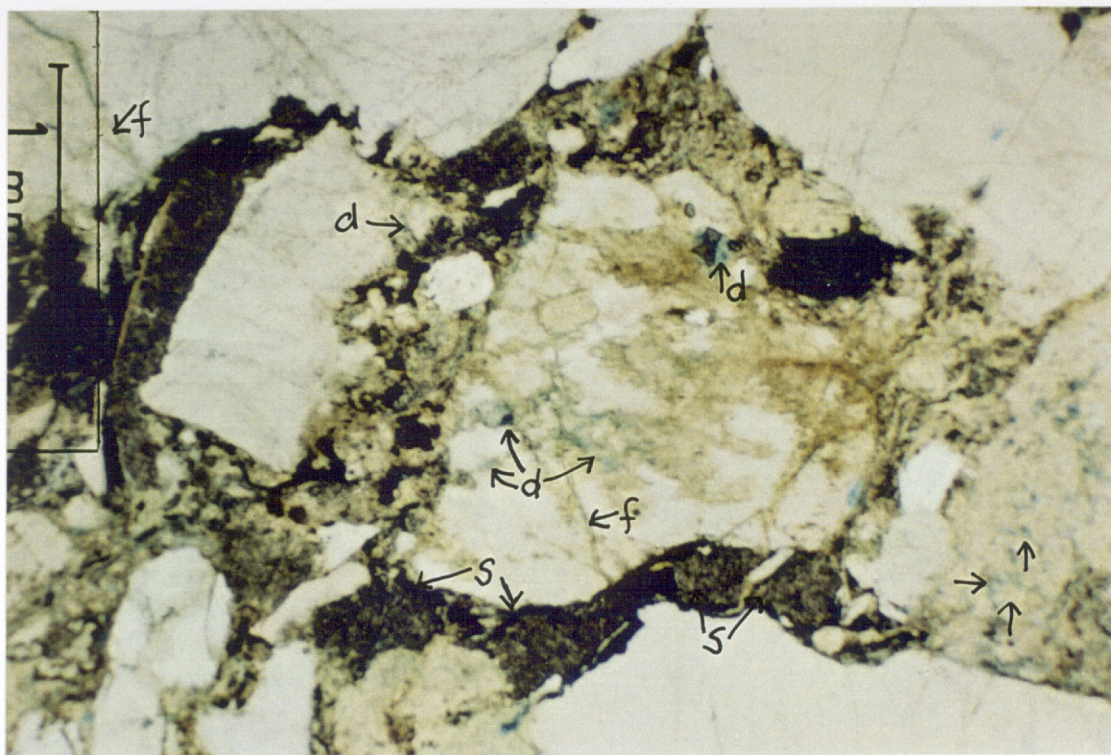


Figure 21, Anemone #1A, junk sub sample, 4676c m. Thin section micrograph demonstrating secondary dissolution porosity (d), especially in the highly altered feldspar, and fracture porosity (f). Microporosity is arrowed in the grain on the right. Organics and aggregates of small anhedral-euhedral spar scalenohedra (S) occur in the matrix.