



2-98 Anemone 1A

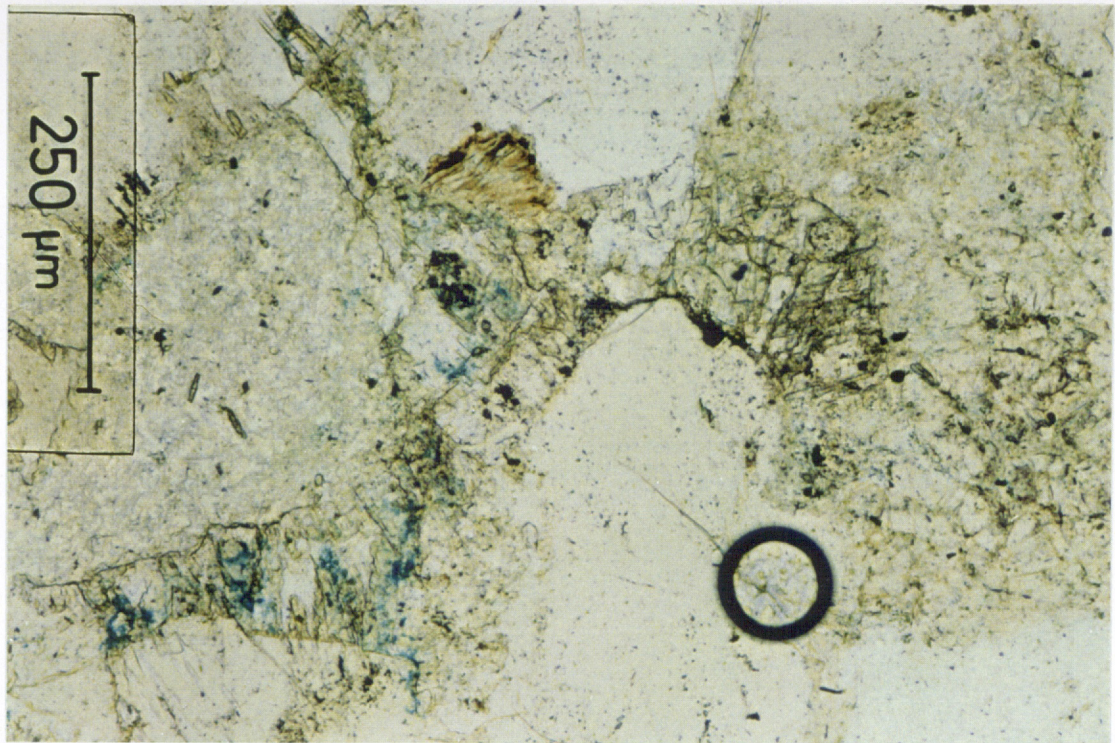


Figure 56 - Anemone #1A, junk sub sample, 4676e m. Extensive dissolution of feldspar grains has produced secondary porosity on the left of the field of view. Clay areas on the right have flecks of microporosity associated. Plane polarized light.